Soft Termination Chip Multilayer Ceramic Capacitors for Automotive GCJ32DR72E224KXJ1_ (1210, X7R:EIA, 0.22uF, DC250V)

_: packaging code

Reference Sheet

1.Scope

This product specification is applied to Soft Termination Chip Multilayer Ceramic Capacitors used for Automotive Electronic equipment.

2.MURATA Part NO. System



3. Type & Dimensions



				(Unit:mm)
(1)-1 L	(1)-2 W	(2) T	e	g
3.2±0.3	2.5±0.2	2.0+0/-0.3	0.3 min.	1.2 min.

4.Rated value

	Characteristics ode):X7R(EIA)	(4) Rated	(5) Nominal	(6) Capacitance	Specifications and Test Methods
Temp. coeff or Cap. Change	Temp. Range (Ref.Temp.)	Voltage	Capacitance	Tolerance	(Operating Temp. Range)
-15 to 15 %	-55 to 125 °C (25 °C)	DC 250 V	0.22 uF	±10 %	-55 to 125 °C

 Soldering Method Reflow

5.Package

mark	(8) Packaging	Packaging Unit
L	∮180mm Reel EMBOSSED W8P4	1000 pcs./Reel
к	∮330mm Reel EMBOSSED W8P4	4000 pcs./Reel

Product specifications in this catalog are as of Oct.19,2018, and are subject to change or obsolescence without notice. Please consult the approval sheet before ordering.

Please read rating and !Cautions first.

AEC-Q200 Murata Standard Specification and Test Methods

No.	AEC-0 Test		Specification	AEC-Q200 Test Method
1	Pre-and Post-Stress Electrical Test			-
2	High Temperatu (Storage) Appearan Capacitan D.F. I.R.	•	The measured and observed characteristics should satisfy the specifications in the following table. No marking defects within $\pm 10\%$ 0.05 max. More than 10,000M\Omega or 100 M Ω ·µF	Sit the capacitor for 1,000±12h at 150±3°C. Let sit for 24±2h at room temperature, then measure.
3	Temperature Cy	alina	(Whichever is smaller) The measured and observed characteristics should	Fix the capacitor to the supporting jig in the same manner and
3	Appearan		satisfy the specifications in the following table. No marking defects within ±10%	under the same conditions as (19). Perform the 1,000 cycles according to the four heat treatments listed in the following table Let sit for 24±2h at *room condition, then measure.
	D.F.	enange	0.05 max.	Step 1 2 3 4
	I.R.		More than 10,000M Ω or 100 M Ω · μ F	
			(Whichever is smaller)	Temp.(°C) -55+0/-3 Room Temp. 125+3/-0 Room Temp. Time(min.) 15±3 1 15±3 1
				•Pretreatment Perform the heat treatment at 150+0/-10°C for 60±5 min and then let sit for 24±2h at *room condition.
4	Destructive Phis	ical Analysis	No defects or abnormalities	Per EIA-469
5	Moisture Resista	се	The measured and observed characteristics should satisfy the specifications in the following table. No marking defects	Apply the 24h heat (25 to 65°C) and humidity (80 to 98%) treatment shown below, 10 consecutive times. Let sit for 24±2h at *room condition, then measure.
		ce Change	within ±12.5%	_
	D.F. I.R.		0.05 max. More than 10,000MΩ or 100 MΩ·μF (Whichever is smaller)	Temperature Humidity Humidity Humidity (°C) 90~98% 90~98% 90~98% 90~98% 70 90~98% 90~98% 90~98% 90~98% 60 90
6	Biased Humidity		The measured and observed characteristics should satisfy the specifications in the following table.	Apply the rated voltage and DC1.3+0.2/-0 V (add $6.8k\Omega$ resistor) at 85±3°C and 80 to 85% humidity for 1,000±12h.
	Appearan Capacitan	ce ice Change	No marking defects within ±12.5%	Remove and let sit for 24±2h at *room condition, then measure. The charge/discharge current is less than 50mA.
	D.F.		0.05 max.	•Pretreatment
	I.R.		More than 1,000M Ω or 10 M Ω · μ F	Perform the heat treatment at 150+0/-10°C for 60±5 min and
7	Operational Life		(Whichever is smaller) The measured and observed characteristics should satisfy the specifications in the following table.	then let sit for 24±2h at *room condition. Apply 150% of the rated voltage for 1,000±12h at 125±3°C. Let sit for 24±2h at *room condition, then measure.
	Appearan		No marking defects	The charge/discharge current is less than 50mA.
		ce Change	within ±12.5%	Pretreatment Apply test voltage for 60+5 min at test temperature
	D.F. I.R.		0.05 max. More than 1,000MΩ or 10 MΩ·μF (Whichever is smaller)	Apply test voltage for 60±5 min at test temperature. Remove and let sit for 24±2h at *room condition.
8	External Visual		No defects or abnormalities	Visual inspection
9	Phisical Dimens	ion	Within the specified dimensions	Using Measuring instrument of dimension.
10	Resistance to Solvents	Appearance Capacitance Change	No marking defects Within the specified tolerance	Per MIL-STD-202 Method 215 Solvent 1 : 1 part (by volume) of isopropyl alcohol 3 parts (by volume) of mineral spirits
		D.F. I.R.	0.025 max. More than 10,000MΩ or 100 MΩ·μF (Whichever is smaller)	Solvent 2 : Terpene defluxer Solvent 3 : 42 parts (by volume) of water 1part (by volume) of propylene glycol monomethyl ether 1 part (by volume) of monoethanolamine

* "room condition" Temperature:15 to 35°C, Relative humidity:45 to 75%, Atmosphere pressure:86 to 106kPa

■AEC-Q200 Murata Standard Specification and Test Methods

No.		-Q200 t Item	Specification			AEC-Q200 T	est Method	
11	Mechanical Appearance Shock Capacitance Change		No marking defects Within the specified tolerance	mutu The s	Three shocks in each direction should be applied along 3 mutually perpendicular axes of the test specimen (18 shock The specified test pulse should be Half-sine and should hav duration :0.5ms, peak value:1,500g and velocity change: 4.		n (18 shocks). should have a	
10	Vibratian	D.F.	0.025 max.					
12	Vibration	Appearance	No defects or abnormalities		er the capacito			
	Capacitance Change D.F.		Within the specified tolerance		same manner and under the same conditions as (19). The capacitor should be subjected to a simple harmonic motion			
			0.025 max.		ng a total ampli		•	
		D.I .	0.025 max.		rmly between t			
					requency rang			-
					ld be traversed			
							-	y perpendicular
					tions (total of 3			y perpendicular
13	Resistance to		The measured and observed characteristics should	-	erse the capaci	,	solution at 260)+5°C
	Soldering Heat		satisfy the specifications in the following table.		$0\pm1s.$ Let sit fo			
	Appeara		No marking defects		reatment		orn conducting t	
	Capacita		within ±10%	Perfo	orm the heat tre	atment at 150	+0/-10°C for 6	0±5 min and
	Change			then	let sit for 24±2	h at *room con	dition.	
	D.F.		0.025 max.					
	I.R.		More than 10,000M Ω or 100 M Ω · μ F					
			(Whichever is smaller)					
14	Thermal Shock	(The measured and observed characteristics should	Fix th	ne capacitor to	the supporting	jig in the sam	e manner and
			satisfy the specifications in the following table.	unde	under the same conditions as (19). Perform the 300 cycles			300 cycles
	Appearance Capacitance Change D.F.		No marking defects	acco	according to the two heat treatments listed in the following table(Maximum transfer time is 20s.). Let sit for 24±2 h at *room condition, then measure.			
			within ±10%					24±2 h at *room
				cond				
			0.025 max.					1
	I.R.		More than 10,000M Ω or 100 M Ω · μ F		· · ·			1
			(Whichever is smaller)		Temp.(°C)	-55+0/-3	125+3/-0	
					Time(min.)	15±3	15±3	
								-
				-	treatment	atment at 150	+0/-10°C for 6	0+5 min and
						eatment at 150+0/-10°C for 60±5 min and h at *room condition.		
15	ESD Appeara	nce	No marking defects	_	AEC-Q200-002			
		ance Change	Within the specified tolerance		20 4200 002			
	D.F.	5	0.025 max.	-				
	I.R.		More than 10,000 M\Omega or 100 M Ω · μ F					
			(Whichever is smaller)					
16	Solderability		95% of the terminations is to be soldered evenly and	(a) P	reheat at 155°	C for 4h. After	preheating, im	merse
			continuously.	tł	ne capacitor in	a solution of e	thanol(JIS K 8	101) and rosin
				(.	JIS K 5902) (25	5% rosin in we	ight propotion)	. Immerse in
				е	utectic solder s	solution for 5+0	0/-0.5s at 235±	5°C.
					hould be place			
					fter preheating			
					thanol (JIS K 8	,	. ,	•
					eight propotior	,	eutectic solde	r solution for
					+0/-0.5s at 235			
					hould be place			
					fter preheating,			
					thanol (JIS K 8	,	. , ,	
					eight propotion	,	euleclic solder	SUIULION TOP
1			35°C. Relative humidity:45 to 75%. Atmosphere pressure		20±5s at 260±5	0.0.		

* "room condition" Temperature:15 to 35°C, Relative humidity:45 to 75%, Atmosphere pressure:86 to 106kPa

AEC-Q200 Murata Standard Specification and Test Methods

17 Electrical Capacitance (Change No defects or abnormalities (Change Visual mapedion. 17 Electrical Capacitance (Change 0.025 max. The capacitancoDF, should be measured at 25°C at the frequency and voltage shown in the table. 18 F. 0.025 max. The insulation resistance should be measured with a (Whichware is smaller) 18. 12°C More than 10,000M2 or 100 M3 µF (Whichware is smaller) The insulation resistance should be measured with a (Whichware is smaller) 18 Roard Agreement Capacitance No failure should be cheared within a 10,000 with a (Whichware is smaller) 18 Board Agreemance Capacitance No marking defects Softer the capacitor on the way (dgs is poold at hown in Fig 1 using a network of primities of a 1. 10 for is in the capacitance and the capacitor on the way (dgs is poold with a 2.0% of the rate voltage) 18 Board Agreemance Capacitance No marking defects Softer the capacitor on the way (dgs is poold with a set shock. 19 Terminal Capacitance Agreemance No marking defects No marking defects Softer the capacitor on the sold (dgs egoop board) shown in Fig 1 using a network capacitor on the way (dgs egoop board) shown in Fig 2 to 6 fairs No fairs work is near working is uniform in the capacitor on the sold (dgs egoop board) shown in Fig 2 to 6 fairs 19 Terminal Capacitance Agreemance <th>No.</th> <th></th> <th>C-Q200 st Item</th> <th>Specification</th> <th>AEC-Q200 Test Method</th>	No.		C-Q200 st Item	Specification	AEC-Q200 Test Method
Character Character Within the specified tolerance The capacitance/D F. should be measured at 25° Cat the frequency and voltage shown in the table. If R. 25° C More than 10,000MD or 100 MD µF The insulation resistance should be measured with a DC 250V±25V at 25° Card 12° Ca with 2° Card integring. IR. 25° C More than 10,000MD or 100 MD µF The insulation resistance should be measured with a DC 250V±25V at 25° Card 12° Ca with 2° Card into 2° Card	17	Electrical	Apperance	No defects or abnormalities	Visual inspection.
$ \begin{array}{ c $		Characte-	Capacitance		The capacitance/D.F. should be measured at 25°C at the
$\begin{tabular}{ c c c c c c } \hline \end{tabular} \\ \hline \end{tabular}$			D.F.	0.025 max.	Frequency Voltage
$\frac{18.25 \ ^{\circ} C}{(24.33 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{18.125 \ ^{\circ} C}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{18.125 \ ^{\circ} C}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More than 10,000 M2 or 100 M2 \mu F} (Whichever is smaller) \\ \frac{10}{(24.34 \ ^{\circ} C)} More Markever is maller) \\ \frac{10}{(24.34 \ ^{\circ} C)} Markever is maller) \\ \frac{10}{(24.34 \ ^{\circ} C)} Markever is maller) \\ \frac{10}{(24.34 \ $					
18 Board Appearance No marking defects 18 Board Appearance No marking defects 19 Terminal Appearance No marking defects 10 Terminal Appearance No marking defects 118 Appearance No marking defects In 119 Terminal Appearance No marking def					
IR. 125°C More than 1,000Mt2 or 10 Mt2;µF Delectric No failure Strength No failure 18 Board Flex Appearance Capacitance within ±12.5% Change Solder the capacitor on the test jig (glass epoxy board) shown in Fig 1 or 5; The soldering should be done shown in Fig 1 or 5; The soldering should be done shown in Fig 1 or 5; The solder show the as heat shock. Image: Solder the capacitor on the test jig (glass epoxy board) shown in Fig 1 or 5; The solder show the capacitor shown in Fig 1 or 5; The solder show the capacitor show the sold be conducted with care so that the soldering is uniform and free of defects such as heat shock. Image: Solder the capacitance within ±12.5% Image: Solder the capacitance (in mm) Image: Solder the capacitance (in the			I.R. 25 °C	More than 10,000MΩ or 100 MΩ·μF	The insulation resistance should be measured with a
$\begin{array}{ c c c c } \hline \\ \hline $					DC 250V \pm 25V at 25 °C and 125 °C within 2 min. of charging.
18 Board Appearance No marking defects Figure a Solder the capacitor on the test ig (glass epoxy board) shown in Fig 2 to 5±1s. The soldering should be conducted with care so that the soldering is uniform and free of defects such as heat shock. 18 Board Appearance No marking defects Figure a Solder the capacitor on the test ig (glass epoxy board) shown in Fig 2 to 5±1s. The soldering should be conducted with care so that the soldering is uniform and free of defects such as heat shock. 19 Figure a Solder the capacitor to the test ig (glass epoxy board) shown in Fig.2 to 5±1s. The soldering shown in Fig.2 to 5±1s. The so			I.R. 125°C	<i>,</i>	
18 Board Flex Appearance Capacitance Change No marking defects (Capacitance Change Solder the capacitor on the test jig (glass epoxy board) shown in Fig 1 using a extertic solder. Then apply a force in the direction shown in Fig 2 or 51s. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. 19 Terminal Appearance Capacitance (Whin specified tolerance Change No marking defects (Min mm) 19 Terminal Strength Appearance Capacitance Change No marking defects (Whin specified tolerance (Whin keys i smaller)) Solder the capacitor to the test jig (glass epoxy board) shown in Fig 3 using a extentic solder. Then apply a force in parallel with the sol sold sold back is shown in Fig 4.5 19 Terminal Capacitance (Whin specified tolerance (Whin keys i smaller)) Solder the capacitor to the test jig (glass epoxy board) shown in Fig 3 using a extence solder. Then apply 18N force in parallel with the test jig for 60s. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. 19 Terminal Change Appearance (Whin keys i smaller) No marking defects (Whin keys i smaller) Solder the capacitor to the test jig (feas conducted with care so that the soldering is uniform and free of defects such as heat shock.				No failure	
18 Board Appearance No marking defects Solder the capacitor on the test jig (glass epoxy board) shown in Fig 2 tor 51:5. The soldering should be done the soldering should be done as of hat the soldering should be done the solder of the solder in the solder of the solder in the solder of the solder in the solder of			Strength		
18 Baard Appearance No marking defects Solder the capacitor on the test jig (glass epoxy board) shown in Fig1 using a eutectic solder. Then apply a force in the soldering is uniform and free of defects such as heat shock. 18 Flex Change Solder the capacitor on the test jig (glass epoxy board) shown in Fig1 to first. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. 19 Terminal Appearance No marking defects 10 Solder the capacitor to the test jig (glass epoxy board) shown 18 Strength Appearance No marking defects 19 Terminal D.F. .0.025 max. 19 Terminal D.F. .0.025 max. 19 Nore in 10.000MΩ or 100 MΩµF Whith see file of the se of the the soldering is uniform and free of defects 19 Terminal More than 10.000MΩ or 100 MΩµF					
18 Board Appearance No marking defects Solder the capacitor on the test jig (glass epoxy board) shown in Fig 2 tor 5±1s. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. 19 Terminal Appearance No marking defects 19 Capacitance meter IFig.3 using a eutectic solder. Then apply 18N force in parallel 19 Terminal Appearance No marking defects 19 Terminal <t< td=""><td></td><td></td><td></td><td></td><td></td></t<>					
FiexCapacitance Changewithin ±12.5%In Fig1 using a eutents solder. Then apply a force in the direction shown in Fig2 tor 5±1s. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock.Image: the solder in the solder i					DC250V 200% of the fated voltage
$\begin{array}{ c c } \hline \\ \hline $	18				
$I = \left[\begin{array}{c c c c c } \\ I = \left[\begin{array}{c c c c } \\ I = \left[\begin{array}{c c c } \\ I = \left[\begin{array}{c c c } \\ I = \left[\begin{array}{c c } \\ I = \left[\left[\begin{array}{c c } \\ I = \left[\left[\begin{array}{c c } \\ I = \left[$		Flex		within ±12.5%	
$ \begin{array}{ c $			Change	L	
$\frac{19}{19} \text{ Terminal Strength} \begin{array}{ c c c } \hline Appearance \\ Capacitance \\ Capacitance \\ Capacitance \\ Change \\ \hline D.F. \\ 0.025 \text{ max.} \\ \hline I.R. \\ (Whichever is smaller) \end{array} \begin{array}{ c c } \hline fig.1 \\ \hline fig.1 \\ \hline fig.1 \\ \hline fig.2 \\ \hline fig.3 \\ \hline fig.$					-
$\frac{ \mathbf{f}_{12} ^2}{ \mathbf{f}_{12} ^2} \frac{ \mathbf{f}_{12} ^2}{ \mathbf{f}_{12} $					
$\begin{array}{ c c c c c } \hline I \\ I \\$					
$\begin{array}{ c c c c c } \hline & & & & & & & & & & & & & & & & & & $					GCJ31 2.0 4.4 1.7
$\begin{array}{ c c c c c } \hline I & I & I & I & I & I & I & I & I & I$					
$\begin{array}{ c c c c } \hline & & & & & & & & & & & & & & & & & & $					
$\begin{array}{ c c c c } \hline & & & & & & & & & & & & & & & & & & $				$ \rightarrow \phi 4.5$	GCJ55 4.2 7.2 5.1
$\begin{array}{ c c c c } \hline & Fig.1 & t : 1.6 \text{mm} \\ \hline & Fig.1 & t : 1.6 \text{mm} \\ \hline & Fig.1 & t : 1.6 \text{mm} \\ \hline & Fig.2 \\ \hline &$					
$\begin{array}{ c c c c c } \hline I \\ I \\$					Fressulizing
$\begin{array}{ c c c c } \hline 100 \\ \hline 100 \\ \hline Fig.1 & t : 1.6 mn \end{array} \qquad $					// [†] Pressurize
$\begin{array}{ c c c c c c } \hline Fig.1 & t : 1.6 \text{mm} \\ \hline Fig.1 & t : 1.6 \text{mm} \\ \hline Fig.2 \\ \hline \hline Fig.3 using a eutectic solder. Then apply 18N force in parallel with the test jig for 60s. \\ \hline \hline D.F. & 0.025 \text{ max.} \\ \hline \hline D.F. & 0.025 \text{ max.} \\ \hline \hline Nore than 10,000 \text{M}\Omega \text{ or } 100 \text{ M}\Omega \mu \text{ F} \\ (Whichever is smaller) \\ \hline \hline \hline Fig.3 using a eutectic solder. Then apply 18N force in parallel with the test jig for 60s. \\ \hline \hline Tre soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. \\ \hline \hline \hline GCJ21 & 1.2 & 4.0 & 1.65 \\ \hline GCJ31 & 2.2 & 5.0 & 2.9 \\ \hline GCJ32 & 2.2 & 5.0 & 2.9 \\ \hline GCJ33 & 3.5 & 7.0 & 3.7 \\ \hline GCJ55 & 4.5 & 8.0 & 5.6 \\ \hline \hline \end{array} $				a /	
Fig.1 t : 1.6mm Capacitance meter 19 Terminal Appearance No marking defects Solder the capacitor to the test jig (glass epoxy board) shown in Fig.3 using a eutectic solder. Then apply 18N force in parallel with the test jig for 60s. D.F. 0.025 max. 1.R. More than 10,000MΩ or 100 MΩ·μF (Whichever is smaller) The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6				100	
Image: Provide the construction of the set of th				Fig 1	Capacitance meter Flexure: ≤ 3mm
19 Terminal Strength Appearance No marking defects Solder the capacitor to the test jig (glass epoxy board) shown in Fig.3 using a eutectic solder. Then apply 18N force in parallel with the test jig for 60s. D.F. 0.025 max. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. I.R. More than 10,000MΩ or 100 MΩ·µF (Whichever is smaller) Type a b c I.R. More than 10,000MΩ or 100 MΩ·µF (Whichever is smaller) Type a b c I.R. More than 10,000MΩ or 100 MΩ·µF (Whichever is smaller) Image: Conducted with care so that the soldering is uniform and free of defects such as heat shock. Image: Conducted with care so that the soldering is uniform and free of GCJ31 2.2 5.0 2.0 I.R. Image: Conducted with care so that the soldering is uniform and free (Whichever is smaller) Image: Conducted with care so that the soldering is uniform and free of GCJ31 2.2 5.0 2.0 I.R. Image: Conducted with care so that the soldering is uniform and free Image: Conducted with care so that the soldering is uniform and free Image: Conducted with care so that the soldering is uniform and free IIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII				rig.i t:1.6mm	45 45
19 Terminal Strength Appearance No marking defects Solder the capacitor to the test jig (glass epoxy board) shown in Fig.3 using a eutectic solder. Then apply 18N force in parallel with the test jig for 60s. D.F. 0.025 max. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. I.R. More than 10,000MΩ or 100 MΩ·µF (Whichever is smaller) Type a b c I.R. More than 10,000MΩ or 100 MΩ·µF (Whichever is smaller) Type a b c I.R. More than 10,000MΩ or 100 MΩ·µF (Whichever is smaller) Image: Conducted with care so that the soldering is uniform and free of defects such as heat shock. Image: Conducted with care so that the soldering is uniform and free of GCJ31 2.2 5.0 2.0 I.R. Image: Conducted with care so that the soldering is uniform and free (Whichever is smaller) Image: Conducted with care so that the soldering is uniform and free of GCJ31 2.2 5.0 2.0 I.R. Image: Conducted with care so that the soldering is uniform and free Image: Conducted with care so that the soldering is uniform and free Image: Conducted with care so that the soldering is uniform and free IIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII					Fig.2
Strength Capacitance Change Within specified tolerance Change in Fig.3 using a eutectic solder. Then apply 18N force in parallel with the test jig for 60s. D.F. 0.025 max. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. I.R. More than 10,000MΩ or 100 MΩ·μF (Whichever is smaller) Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6					3
Changewith the test jig for 60s.D.F.0.025 max.The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock.I.R.More than 10,000 MΩ or 100 MΩ·μF (Whichever is smaller)be conducted with care so that the soldering is uniform and free of defects such as heat shock.TypeabcGCJ211.24.01.65GCJ312.25.02.0GCJ322.25.02.9GCJ433.57.03.7GCJ554.58.05.6	19				
D.F. 0.025 max. The soldering should be done by the reflow method and should be conducted with care so that the soldering is uniform and free of defects such as heat shock. I.R. More than 10,000 MΩ or 100 MΩ·μF (Whichever is smaller) The soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6		Strength		Within specified tolerance	
I.R. More than 10,000MΩ or 100 MΩ·μF (Whichever is smaller) be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6					with the test lig for bus.
Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6				0 025 max	The soldering should be done by the reflow method and should
$\begin{array}{ c c c c c c c c }\hline GCJ21 & 1.2 & 4.0 & 1.65 \\ \hline GCJ31 & 2.2 & 5.0 & 2.0 \\ \hline GCJ32 & 2.2 & 5.0 & 2.9 \\ \hline GCJ43 & 3.5 & 7.0 & 3.7 \\ \hline GCJ55 & 4.5 & 8.0 & 5.6 \\ \hline \end{array}$					
GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free
GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6 (in mm)				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock.
GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6 (in mm)				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c
GCJ55 4.5 8.0 5.6 (in mm)				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0
(in mm)				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7
				More than 10,000M Ω or 100 M Ω · μ F	Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ55 4.5 8.0 5.6
				More than 10,000M Ω or 100 M Ω · μ F	Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ55 4.5 8.0 5.6
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6 (in mm)
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6 (in mm)
Solder resist				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6 (in mm)
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. Type a b c GCJ21 1.2 4.0 1.65 GCJ31 2.2 5.0 2.0 GCJ32 2.2 5.0 2.9 GCJ43 3.5 7.0 3.7 GCJ55 4.5 8.0 5.6 (in mm)
				More than 10,000M Ω or 100 M Ω · μ F	be conducted with care so that the soldering is uniform and free of defects such as heat shock. $\begin{array}{rrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrr$

■AEC-Q200 Murata Standard Specification and Test Methods

No.	AEC-Q200 Test Item	Specification	AEC-Q200 Test Method	
20	Beam Load Test	Destruction value should be exceed following one. Chip thickness < 1.25mm rank : 15N Chip thickness ≥ 1.25mm rank : 54.5N	Place the capacitor in the beam load fixture as Fig 4. Apply a force.	
21	Capacitance Capacitance within ±15%	The capacitance change should be measured after 5min. at		
	Temperature Change Characteris-		each specified temperature stage.	
	tics		Step Temperature(°C)	
			1 25±2	
			2 -55±3	
			3 25±2	
			4 125±3	
			5 25±2	
			The ranges of capacitance change compared with the above 25°C value over the temperature ranges shown in the table should be within the specified ranges. •Pretreatment Perform the heat treatment at 150+0/-10°C for 60±5 min are then let sit for 24±2h at *room condition. Perform the initial measurement.	9

* "room condition" Temperature:15 to 35°C, Relative humidity:45 to 75%, Atmosphere pressure:86 to 106kPa

Package

(1) Appearance of taping

(a) Paper Tape

Bottom Tape (Thickness: Around $50\mu m$) is attached below Base Tape with sprocket and put Top Tape (Thickness: Around $50\mu m$) on capacitor.

(b) Plastic Tape

Cover Tape (Thickness: Around 60µm) is put on capacitor on Base Tape (Blister carrier Tape).

- (c) The sprocket holes are to the right as the Tape is pulled toward the user.
- (2) Packed chips



(3) Dimensions of Tape


(a) Type A (Dimensions of chip : Apply to 1.6x0.8, 2.0x1.25, 3.2x1.6, 3.2x2.5)



(Unit : mm)

	Dimensions of chip [L×W]	A*	B*	
l	1.6×0.8	1.05	1.85	
	2.0×1.25	1.45	2.25	
	3.2×1.6	2.0	3.6	
	3.2×2.5	2.9	3.6	*Dimensions of A,B : Nominal value

(b) Type B (Dimensions of chip : Apply to 4.5x2.0)

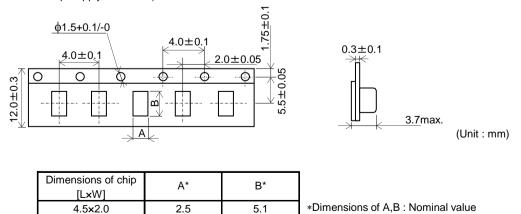

Package

(c) Type C (Dimensions of chip : Apply to 4.5x3.2 to 5.7x5.0)



(5) Part of the leader and part of the empty tape shall be attached to the end of the tape as follows.




(Unit : mm)

(6) The top tape or cover tape and base tape are not attached at the end of the tape for a minimum of 5 pitches.

- (7) Missing capacitors number within 0.1% of the number per reel or 1pc, whichever is greater, and not continuous.
- (8) The top tape or cover tape and bottom tape shall not protrude beyond the edges of the tape and shall not cover sprocket holes.
- (9) Cumulative tolerance of sprocket holes, 10 pitches : ±0.3mm.

(10) Peeling off force : 0.1 to 0.6N in the direction shown on the follows.



■Limitation of Applications

Please contact us before using our products for the applications listed below which require especially high reliability for the prevention of defects which might directly cause damage to the third party's life, body or property.

①Aircraft equipment
 ②Aerospace equipment
 ③Undersea equipment
 ④Power plant control equipment
 ⑤Medical equipment
 ⑥Transportation equipment(vehicles,trains,ships,etc.)
 ⑦Traffic signal equipment
 ⑧Data-processing equipment
 ⑩Application of similar complexity and/or reliability requirements to the applications listed in the above.

■ Storage and Operation condition

- 1. The performance of chip multilayer ceramic capacitors (henceforth just "capacitors") may be affected by the storage conditions. Please use them promptly after delivery.
- 1-1. Maintain appropriate storage for the capacitors using the following conditions: Room Temperature of +5°C to +40°C and a Relative Humidity of 20% to 70%.

High temperature and humidity conditions and/or prolonged storage may cause deterioration of the packaging materials. If more than six months have elapsed since delivery, check packaging, mounting, etc. before use. In addition, this may cause oxidation of the electrodes. If more than one year has elapsed since delivery, also check the solderability before use.

- 1-2. Corrosive gas can react with the termination (external) electrodes or lead wires of capacitors, and result in poor solderability. Do not store the capacitors in an atmosphere consisting of corrosive gas (e.g.,hydrogen sulfide, sulfur dioxide, chlorine, ammonia gas etc.).
- 1-3. Due to moisture condensation caused by rapid humidity changes, or the photochemical change caused by direct sunlight on the terminal electrodes and/or the resin/epoxy coatings, the solderability and electrical performance may deteriorate. Do not store capacitors under direct sunlight or in high huimidity conditions

Rating

1.Temperature Dependent Characteristics

- 1. The electrical characteristics of the capacitor can change with temperature.
- 1-1. For capacitors having larger temperature dependency, the capacitance may change with temperature changes. The following actions are recommended in order to ensure suitable capacitance values.
 - (1) Select a suitable capacitance for the operating temperature range.
- (2) The capacitance may change within the rated temperature. When you use a high dielectric constant type capacitor in a circuit that needs a tight (narrow) capacitance tolerance (e.g., a time-constant circuit), please carefully consider the temperature characteristics, and

carefully confirm the various characteristics in actual use conditions and the actual system.

2.Measurement of Capacitance


1. Measure capacitance with the voltage and frequency specified in the product specifications.

- 1-1. The output voltage of the measuring equipment may decrease occasionally when capacitance is high. Please confirm whether a prescribed measured voltage is impressed to the capacitor.
- 1-2. The capacitance values of high dielectric constant type capacitors change depending on the AC voltage applied. Please consider the AC voltage characteristics when selecting a capacitor to be used in a AC circuit.

3.Applied Voltage

1. Do not apply a voltage to the capacitor that exceeds the rated voltage as called out in the specifications.

- 1-1. Applied voltage between the terminals of a capacitor shall be less than or equal to the rated voltage.
- (1) When AC voltage is superimposed on DC voltage, the zero-to-peak voltage shall not exceed the rated DC voltage. When AC voltage or pulse voltage is applied, the peak-to-peak voltage shall not exceed the rated DC voltage.
- (2) Abnormal voltages (surge voltage, static electricity, pulse voltage, etc.) shall not exceed the rated DC voltage.

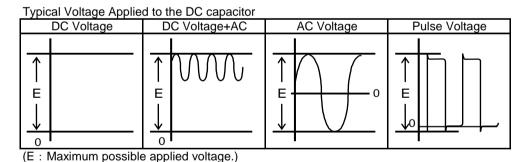

1-2. Influence of over voltage

Over voltage that is applied to the capacitor may result in an electrical short circuit caused by the breakdown of the internal dielectric layers .

The time duration until breakdown depends on the applied voltage and the ambient temperature.

2. Use a safety standard certified capacitor in a power supply input circuit (AC filter), as it is also necessary to consider the withstand voltage and impulse withstand voltage defined for each device.

4.Type of Applied Voltage and Self-heating Temperature

1.Confirm the operating conditions to make sure that no large current is flowing into the capacitor due to the continuous application of an AC voltage or pulse voltage.

When a DC rated voltage product is used in an AC voltage circuit or a pulse voltage circuit, the AC current or pulse current will flow into the capacitor; therefore check the self-heating condition.

Please confirm the surface temperature of the capacitor so that the temperature remains within the upper limits of the operating temperature, including the rise in temperature due to self-heating. When the capacitor is used with a high-frequency voltage or pulse voltage, heat may be generated by dielectric loss.

<Applicable to Temperature Characteristic X7R(R7), X7T(D7)>

1-1. The load should be contained so that the self-heating of the capacitor body remains below 20°C, when measuring at an ambient temperature of 25°C. In addition, use a K thermocouple of Ø0.1mm with less heat capacity when measuring, and measure in a condition where there is no effect from the radiant heat of other components or air flow caused by convection. Excessive generation of heat may cause deterioration of the characteristics and reliability of the capacitor. (Absolutely do not perform measurements while the cooling fan is operating, as an accurate measurement may not be performed.)

5. DC Voltage and AC Voltage Characteristic

- 1. The capacitance value of a high dielectric constant type capacitor changes depending on the DC voltage applied. Please consider the DC voltage characteristics when a capacitor is selected for use in a DC circuit.
- 1-1. The capacitance of ceramic capacitors may change sharply depending on the applied voltage. (See figure) Please confirm the following in order to secure the capacitance.
- (1) Determine whether the capacitance change caused by the applied voltage is within the allowed range .
- (2) In the DC voltage characteristics, the rate of capacitance change becomes larger as voltageincreases, even if the applied voltage is below the rated voltage. When a high dielectric constant type capacitor is used in a circuit that requires a tight (narrow) capacitance tolerance (e.g., a time constant circuit), please carefully consider the voltage characteristics, and confirm the various characteristics in the actual operating conditions of the system.
- 2. The capacitance values of high dielectric constant type capacitors changes depending on the AC voltage applied. Please consider the AC voltage characteristics when selecting a capacitor to be used in an AC circuit.


6. Capacitance Aging

1. The high dielectric constant type capacitors have an Aging characteristic in which the capacitance value decreases with the passage of time.

When you use a high dielectric constant type capacitors in a circuit that needs a tight (narrow) capacitance tolerance (e.g., a time-constant circuit), please carefully consider the characteristics of these capacitors, such as their aging, voltage, and temperature characteristics. In addition, check capacitors using your actual appliances at the intended environment and operating conditions.

7.Vibration and Shock


- 1. Please confirm the kind of vibration and/or shock, its condition, and any generation of resonance. Please mount the capacitor so as not to generate resonance, and do not allow any impact on the terminals.
- Mechanical shock due to being dropped may cause damage or a crack in the dielectric material of the capacitor.
 Do not use a dropped capacitor because the quality and reliability may be deteriorated.
- 3. When printed circuit boards are piled up or handled, the corner of another printed circuit board should not be allowed to hit the capacitor in order to avoid a crack or other damage to the capacitor.

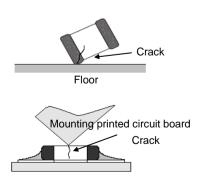

■Soldering and Mounting

1.Mounting Position

- 1. Confirm the best mounting position and direction that minimizes the stress imposed on the capacitor during flexing or bending the printed circuit board.
- 1-1.Choose a mounting position that minimizes the stress imposed on the chip during flexing or bending of the board. [Component Direction]




Locate chip horizontal to the direction in which stress acts.

[Chip Mounting Close to Board Separation Point]

It is effective to implement the following measures, to reduce stress in separating the board. It is best to implement all of the following three measures; however, implement as many measures as possible to reduce stress.


Contents of Measures	Stress Level
(1) Turn the mounting direction of the component parallel to the board separation surface.	A > D *1
(2) Add slits in the board separation part.	A > B
(3) Keep the mounting position of the component away from the board separation surface.	A > C

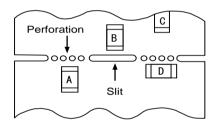

*1 A > D is valid when stress is added vertically to the perforation as with Hand Separation. If a Cutting Disc is used, stress will be diagonal to the PCB, therefore A > D is invalid.

[Mounting Capacitors Near Screw Holes]

When a capacitor is mounted near a screw hole, it may be affected by the board deflection that occurs during the tightening of the screw. Mount the capacitor in a position as far away from the screw holes as possible.




2.Information before Mounting

- 1. Do not re-use capacitors that were removed from the equipment.
- 2. Confirm capacitance characteristics under actual applied voltage.
- 3. Confirm the mechanical stress under actual process and equipment use.
- 4. Confirm the rated capacitance, rated voltage and other electrical characteristics before assembly.
- 5. Prior to use, confirm the solderability of capacitors that were in long-term storage.
- 6. Prior to measuring capacitance, carry out a heat treatment for capacitors that were in long-term storage.
- 7. The use of Sn-Zn based solder will deteriorate the reliability of the MLCC. Please contact our sales representative or product engineers on the use of Sn-Zn based solder in advance.

3.Maintenance of the Mounting (pick and place) Machine


- 1. Make sure that the following excessive forces are not applied to the capacitors. Check the mounting in the actual device under actual use conditions ahead of time.
- 1-1. In mounting the capacitors on the printed circuit board, any bending force against them shall be kept to a minimum to prevent them from any damage or cracking. Please take into account the following precautions and recommendations for use in your process.
- (1) Adjust the lowest position of the pickup nozzle so as not to bend the printed circuit board.

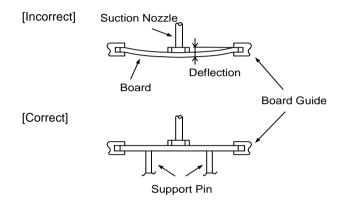


2.Dirt particles and dust accumulated in the suction nozzle and suction mechanism prevent the nozzle from moving smoothly. This creates excessive force on the capacitor during mounting, causing cracked chips. causing cracked chips. Also, the locating claw, when worn out, imposes uneven forces on the chip when positioning, causing cracked chips. The suction nozzle and the locating claw must be maintained, checked and replaced periodically.

4-1.Reflow Soldering

- 1. When sudden heat is applied to the components, the mechanical strength of the components will decrease because a sudden temperature change causes deformation inside the components. In order to prevent mechanical damage to the components, preheating is required for both the components and the PCB. Preheating conditions are shown in table 1. It is required to keep the temperature differential between the solder and the components surface (Δ T) as small as possible.
- 2. When components are immersed in solvent after mounting, be sure to maintain the temperature difference (Δ T) between the component and the solvent within the range shown in the table 1.

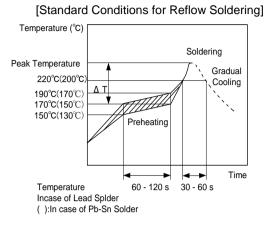

[Allowable Reflow Soldering Temperature and Time]

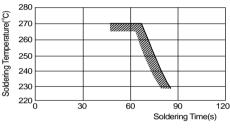

In the case of repeated soldering, the accumulated soldering time must be within the range shown above.

Series	Chip Dimension(L/W) Code	Temperature Differential
GC□	21/31	ΔT≦190°C
GC□	32/43/55	ΔT≦130°C
-		

Recommended Conditions

Table 1

	Pb-Sn Solder	Lead Free Solder
Peak Temperature	230 to 250°C	240 to 260°C
Atmosphere	Air	Air or N ₂

Pb-Sn Solder : Sn-37Pb

Lead Free Solder : Sn-3.0Ag-0.5Cu

- 3. When a capacitor is mounted at a temperature lower than the peak reflow temperature recommended by the solder manufacturer, the following quality problems can occur. Consider factors such as the placement of peripheral components and the reflow temperature setting to prevent the capacitor's reflow temperature from dropping below the peak temperature specified. Be sure to evaluate the mounting situation beforehand and verify that none of the following problems occur.
 - · Drop in solder wettability
 - ·Solder voids
 - ·Possible occurrence of whiskering
 - ·Drop in bonding strength
 - ·Drop in self-alignment properties
- ·Possible occurrence of tombstones and/or shifting on the land patterns of the circuit board
- 4. Optimum Solder Amount for Reflow Soldering
- 4-1. Overly thick application of solder paste results in a excessive solder fillet height. This makes the chip more susceptible to mechanical and thermal stress on the board and may cause the chips to crack.
- 4-2. Too little solder paste results in a lack of adhesive strength on the termination, which may result in chips breaking loose from the PCB.
- 4-3. Please confirm that solder has been applied smoothly to the termination.

Inverting the PCB

Make sure not to impose any abnormal mechanical shocks to the PCB.

4-2.Flow Soldering

1. Do not apply flow soldering to chips not listed in Table 2.

Table 2


Series	Chip Dimension(L/W) Code	Temperature Differential
GC□	21/31	ΔT≦150°C

- 2. When sudden heat is applied to the components, the mechanical strength of the components will decrease because a sudden temperature change causes deformation inside the components. In order to prevent mechanical damage to the components, preheating is required for both of the components and the PCB. Preheating conditions are shown in table 2. It is required to keep the temperature differential between the solder and the components surface (ΔT) as low as possible.
- 3. Excessively long soldering time or high soldering temperature can result in leaching of the terminations, causing poor adhesion or a reduction in capacitance value due to loss of contact between the inner electrodes and terminations.
- 4. When components are immersed in solvent after mounting, be sure to maintain the temperature differential (ΔT) between the component and solvent within the range shown in the table 2.

Recommended Conditions

Temperature(°C) Soldering Peak Temperature Preheating Peak Temperature	ΔT Preheating	s	olde	ring Gradual Cooling
		5 s		Time nds max.

[Allowable Flow Soldering Temperature and Time]

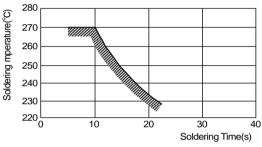


In the case of repeated soldering, the accumulated soldering time must be within the range shown above.

	Pb-Sn Solder	Lead Free Solder
Preheating Peak Temperature	90 to 110°C	100 to 120°C
Soldering Peak Temperature	240 to 250°C	250 to 260°C
Atmosphere	Air	Air or N2

Pb-Sn Solder : Sn-37Pb

Lead Free Solder : Sn-3.0Ag-0.5Cu

- 5. Optimum Solder Amount for Flow Soldering
- 5-1. The top of the solder fillet should be lower than the thickness of the components. If the solder amount is excessive, the risk of cracking is higher during board bending or any other stressful condition.

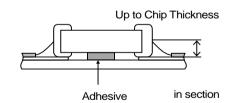

[Standard Conditions for Flow Soldering]

4-3.Correction of Soldered Portion

When sudden heat is applied to the capacitor, distortion caused by the large temperature difference occurs internally, and can be the cause of cracks. Capacitors also tend to be affected by mechanical and thermal stress depending on the board preheating temperature or the soldering fillet shape, and can be the cause of cracks. Please refer to "1. PCB Design" or "3. Optimum solder amount" for the solder amount and the fillet shapes.

1. Correction with a Soldering Iron

- 1-1. In order to reduce damage to the capacitor, be sure to preheat the capacitor and the mounting board.
- Preheat to the temperature range shown in Table 3. A hot plate, hot air type preheater, etc. can be used for preheating. 1-2. After soldering, do not allow the component/PCB to cool down rapidly.
- 1-3. Perform the corrections with a soldering iron as quickly as possible. If the soldering iron is applied too long, there is a possibility of causing solder leaching on the terminal electrodes, which will cause deterioration of the adhesive strength and other problems.

Table 3

Series	Chip Dimension (L/W) Code	Temperature of Soldering Iron Tip	Preheating Temperature	Temperature Differential(ΔT)	Atmosphere
GC□	21/31	350°C max.	150°C min.	ΔT≦190°C	Air
GC□	32/43/55	280°C max.	150°C min.	ΔT≦130°C	Air

*Applicable for both Pb-Sn and Lead Free Solder.

Pb-Sn Solder : Sn-37Pb

Lead Free Solder : Sn-3.0Ag-0.5Cu

*Please manage Δ T in the temperature of soldering iron and the preheating temperature.


2. Correction with Spot Heater

Compared to local heating with a soldering iron, hot air heating by a spot heater heats the overall component and board, therefore, it tends to lessen the thermal shock. In the case of a high density mounted board, a spot heater can also prevent concerns of the soldering iron making direct contact with the component.

- 2-1. If the distance from the hot air outlet of the spot heater to the component is too close, cracks may occur due to thermal shock. To prevent this problem, follow the conditions shown in Table 4.
- 2-2. In order to create an appropriate solder fillet shape, it is recommended that hot air be applied at the angle shown in Figure 1.

.9	~	-		•	
	Т	a	hl	е	4

Distance	5mm or more	
Hot Air Application angle	45° *Figure 1	
Hot Air Temperature Nozzle Outlet	400°C max.	
	Less than 10 seconds	
Application Time	(3216M / 1206 size or smaller)	
	Less than 30 seconds	
	(3225M / 1210 size or larger)	(3216M, 3225M: Metric size code)

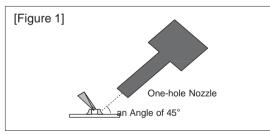

- 3. Optimum solder amount when re-working with a soldering iron
- 3-1. If the solder amount is excessive, the risk of cracking is higher during board bending or any other stressful condition. Too little solder amount results in a lack of adhesive strength on the termination, which may result in chips breaking loose from the PCB.

Please confirm that solder has been applied smoothly is and rising to the end surface of the chip.

- 3-2. A soldering iron with a tip of ø3mm or smaller should be used. It is also necessary to keep the soldering iron from touching the components during the re-work.
- 3-3. Solder wire with Ø0.5mm or smaller is required for soldering.



in section

5.Washing

Excessive ultrasonic oscillation during cleaning can cause the PCBs to resonate, resulting in cracked chips or broken solder joints. Before starting your production process, test your cleaning equipment / process to insure it does not degrade the capacitors.

6.Electrical Test on Printed Circuit Board

- 1. Confirm position of the support pin or specific jig, when inspecting the electrical performance of a capacitor after mounting on the printed circuit board.
 - 1-1. Avoid bending the printed circuit board by the pressure of a test-probe, etc. The thrusting force of the test probe can flex the PCB, resulting in cracked chips or open solder joints. Provide support pins on the back side of the PCB to prevent warping or flexing. Install support pins as close to the test-probe as possible.
 - 1-2. Avoid vibration of the board by shock when a test -probe contacts a printed circuit board.



7.Printed Circuit Board Cropping

- 1. After mounting a capacitor on a printed circuit board, do not apply any stress to the capacitor that caused bending or twisting the board.
 - 1-1. In cropping the board, the stress as shown may cause the capacitor to crack. Cracked capacitors may cause deterioration of the insulation resistance, and result in a short. Avoid this type of stress to a capacitor.





2. Check the cropping method for the printed circuit board in advance.

2-1. Printed circuit board cropping shall be carried out by using a jig or an apparatus (Disc separator, router type separator, etc.) to prevent the mechanical stress that can occur to the board.

Board Separation Method	Hand Separation	(1) Board Separation Jig	Board Separation Apparatus		
	Nipper Separation (1) Board Separation Jig		Disc Separator	3) Router Type Separator	
Level of stress on board	High	Medium	Medium	Low	
Recommended	×	Δ^*	Δ^*	\bigcirc	
	Hand and nipper separation apply a high level of stress. Use another method.	 Board handling Board bending direction Layout of capacitors 	 Board handling Layout of slits Design of V groove Arrangement of blades Controlling blade life 	Board handling	

* When a board separation jig or disc separator is used, if the following precautions are not observed, a large board deflection stress will occur and the capacitors may crack. Use router type separator if at all possible.

(1) Example of a suitable jig

[In the case of Single-side Mounting]

An outline of the board separation jig is shown as follows.

Recommended example: Stress on the component mounting position can be minimized by holding the portion close to the jig, and bend in the direction towards the side where the capacitors are mounted. Not recommended example: The risk of cracks occurring in the capacitors increases due to large stress being applied to the component mounting position, if the portion away from the jig is held and bent in the direction opposite the side where the capacitors are mounted.

[Outline of jig]

[Hand Separation]



[In the case of Double-sided Mounting]

Since components are mounted on both sides of the board, the risk of cracks occurring can not be avoided with the above method. Therefore, implement the following measures to prevent stress from being applied to the components. (Measures)


- (1) Consider introducing a router type separator.
 - If it is difficult to introduce a router type separator, implement the following measures. (Refer to item 1. Mounting Position)
- (2) Mount the components parallel to the board separation surface.
- (3) When mounting components near the board separation point, add slits in the separation position near the component.
- (4) Keep the mounting position of the components away from the board separation point.


(2) Example of a Disc Separator

An outline of a disc separator is shown as follows. As shown in the Principle of Operation, the top blade and bottom blade are aligned with the V-grooves on the printed circuit board to separate the board. In the following case, board deflection stress will be applied and cause cracks in the capacitors.

- (1) When the adjustment of the top and bottom blades are misaligned, such as deviating in the top-bottom, left-right or front-rear directions
- (2) The angle of the V groove is too low, depth of the V groove is too shallow, or the V groove is misaligned top-bottom

IF V groove is too deep, it is possible to brake when you handle and carry it. Carefully design depth of the V groove with consideration about strength of material of the printed circuit board.

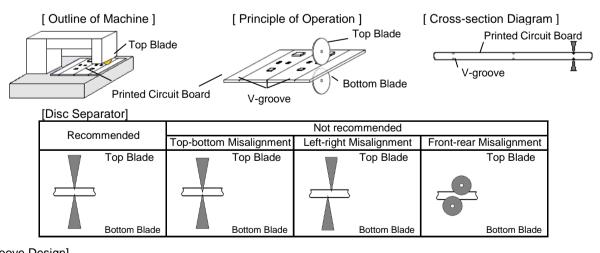

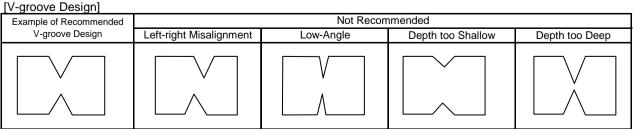

muRata ∆Caution

(3) Example of Router Type Separator

The router type separator performs cutting by a router rotating at a high speed. Since the board does not bend in the cutting process, stress on the board can be suppressed during board separation. When attaching or removing boards to/from the router type separator, carefully handle the boards to prevent bending.

8. Assembly

1. Handling

If a board mounted with capacitors is held with one hand, the board may bend. Firmly hold the edges of the board with both hands when handling. If a board mounted with capacitors is dropped, cracks may occur in the capacitors.

Do not use dropped boards, as there is a possibility that the quality of the capacitors may be impaired.

2. Attachment of Other Components


2-1. Mounting of Other Components

Pay attention to the following items, when mounting other components on the back side of the board after capacitors have been mounted on the opposite side.

When the bottom dead point of the suction nozzle is set too low, board deflection stress may be applied to the capacitors on the back side (bottom side), and cracks may occur in the capacitors.

· After the board is straightened, set the bottom dead point of the nozzle on the upper surface of the board.

· Periodically check and adjust the bottom dead point.



- 2-2. Inserting Components with Leads into Boards
 - When inserting components (transformers, IC, etc.) into boards, bending the board may cause cracks in the capacitors or cracks in the solder. Pay attention to the following.
 - · Increase the size of the holes to insert the leads, to reduce the stress on the board during insertion.
 - Fix the board with support pins or a dedicated jig before insertion.
 - Support below the board so that the board does not bend. When using support pins on the board, periodically confirm that there is no difference in the height of each support pin.

Component with Leads



2-3. Attaching/Removing Sockets and/or Connectors


Insertion and removal of sockets and connectors, etc., might cause the board to bend. Please insure that the board does not warp during insertion and removal of sockets and connectors, etc., or the bending may damage mounted components on the board.




2-4. Tightening Screws

The board may be bent, when tightening screws, etc. during the attachment of the board to a shield or chassis. Pay attention to the following items before performing the work.

- · Plan the work to prevent the board from bending.
- · Use a torque screwdriver, to prevent over-tightening of the screws.
- The board may bend after mounting by reflow soldering, etc. Please note, as stress may be applied to the chips by forcibly flattening the board when tightening the screws.





Others

1. Under Operation of Equipment

- 1-1. Do not touch a capacitor directly with bare hands during operation in order to avoid the danger of an electric shock.
- 1-2. Do not allow the terminals of a capacitor to come in contact with any conductive objects (short-circuit). Do not expose a capacitor to a conductive liquid, inducing any acid or alkali solutions.
- 1-3. Confirm the environment in which the equipment will operate is under the specified conditions.
 - Do not use the equipment under the following environments.
 - (1) Being spattered with water or oil.
 - (2) Being exposed to direct sunlight.
 - (3) Being exposed to ozone, ultraviolet rays, or radiation.
 - (4) Being exposed to toxic gas (e.g., hydrogen sulfide, sulfur dioxide, chlorine, ammonia gas etc.)
 - (5) Any vibrations or mechanical shocks exceeding the specified limits.
 - (6) Moisture condensing environments.
- 1-4. Use damp proof countermeasures if using under any conditions that can cause condensation.

2. Others

- 2-1. In an Emergency
- (1) If the equipment should generate smoke, fire, or smell, immediately turn off or unplug the equipment. If the equipment is not turned off or unplugged, the hazards may be worsened by supplying continuous power.
- (2) In this type of situation, do not allow face and hands to come in contact with the capacitor or burns may be caused by the capacitor's high temperature.
- 2-2. Disposal of waste

When capacitors are disposed of, they must be burned or buried by an industrial waste vendor with the appropriate licenses.

- 2-3. Circuit Design
- (1) Addition of Fail Safe Function

Capacitors that are cracked by dropping or bending of the board may cause deterioration of the insulation resistance, and result in a short. If the circuit being used may cause an electrical shock, smoke or fire when a capacitor is shorted, be sure to install fail-safe functions, such as a fuse, to prevent secondary accidents.

(2) Capacitors used to prevent electromagnetic interference in the primary AC side circuit, or as a connection/insulation, must be a safety standard certified product, or satisfy the contents stipulated in the Electrical Appliance and Material Safety Law. Install a fuse for each line in case of a short.

(3) This series is not safety standard certified products.

2-4. Remarks

Failure to follow the cautions may result, worst case, in a short circuit and smoking when the product is used. The above notices are for standard applications and conditions. Contact us when the products are used in special mounting conditions.

Select optimum conditions for operation as they determine the reliability of the product after assembly. The data herein are given in typical values, not guaranteed ratings.

muRata Notice

Rating

1.Operating Temperature

- 1. The operating temperature limit depends on the capacitor.
- 1-1. Do not apply temperatures exceeding the maximum operating temperature.
 It is necessary to select a capacitor with a suitable rated temperature that will cover the operating temperature range.
 It is also necessary to consider the temperature distribution in equipment and the seasonal temperature variable factor.
- 1-2. Consider the self-heating factor of the capacitor The surface temperature of the capacitor shall not exceed the maximum operating temperature including self-heating.

2.Atmosphere Surroundings (gaseous and liquid)

- 1. Restriction on the operating environment of capacitors.
- 1-1. Capacitors, when used in the above, unsuitable, operating environments may deteriorate due to the corrosion of the terminations and the penetration of moisture into the capacitor.
- 1-2. The same phenomenon as the above may occur when the electrodes or terminals of the capacitor are subject to moisture condensation.
- 1-3. The deterioration of characteristics and insulation resistance due to the oxidization or corrosion of terminal electrodes may result in breakdown when the capacitor is exposed to corrosive or volatile gases or solvents for long periods of time.

3.Piezo-electric Phenomenon

 When using high dielectric constant type capacitors in AC or pulse circuits, the capacitor itself vibrates at specific frequencies and noise may be generated. Moreover, when the mechanical vibration or shock is added to capacitor, noise may occur.

■Soldering and Mounting

1.PCB Design

Pattern Forme

- 1. Notice for Pattern Forms
- 1-1. Unlike leaded components, chip components are susceptible to flexing stresses since they are mounted directly on the substrate.
 They are also more sensitive to mechanical and thermal stresses than leaded components.
 Excess solder fillet height can multiply these stresses and cause chip cracking.
 When designing substrates, take land patterns and dimensions into consideration to eliminate the possibility of excess solder fillet height.
- 1-2. There is a possibility of chip cracking caused by PCB expansion/contraction with heat, because stress on a chip is different depending on PCB material and structure. When the thermal expansion coefficient greatly differs between the board used for mounting and the chip, it will cause cracking of the chip due to the thermal expansion and contraction. When capacitors are mounted on a fluorine resin printed circuit board or on a single-layered glass epoxy board, it may also cause cracking of the chip for the same reason.

	Prohibited	Correct
Placing Close to Chassis	Chassis Solder (ground) Electrode Pattern in section	Solder Resist
Placing of Chip Components and Leaded Components	Lead Wire in section	Solder Resist
Placing of Leaded Components after Chip Component	Soldering Iron Lead Wire	Solder Resist in section
Lateral Mounting		Solder Resist

Notice

2. Land Dimensions

Please confirm the suitable land dimension by evaluating of the actual SET / PCB.

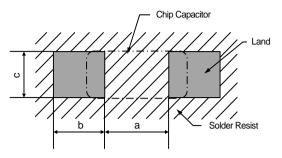


Table 1 Flow Soldering Method

Series	Chip Dimension (L/W) Code	Chip(L×W)	а	b	с
GC□	21	2.0×1.25	1.0 to 1.2	0.9 to 1.0	0.8 to 1.1
GC□	31	3.2×1.6	2.2 to 2.6	1.0 to 1.1	1.0 to 1.4

Flow soldering can only be used for products with a chip size of 2.0x1.25mm to 3.2x1.6mm. (in mm) Resistance to PCB bending stress may be improved by designing the "a" dimension with solder resist.

Table 2 Reflow Soldering Method

Table 2 Renow Soldering Method					
Series	Chip Dimension (L/W) Code	Chip(L×W)	а	b	с
GC□	21	2.0×1.25	1.0 to 1.2	0.6 to 0.7	0.8 to 1.1
GC□	31	3.2×1.6	2.2 to 2.4	0.8 to 0.9	1.0 to 1.4
GC□	32	3.2×2.5	2.0 to 2.4	1.0 to 1.2	1.8 to 2.3
GC□	43	4.5×3.2	3.0 to 3.5	1.2 to 1.4	2.3 to 3.0
GC□	55	5.7×5.0	4.0 to 4.6	1.4 to 1.6	3.5 to 4.8
					(in mana)

(in mm)

<Applicable to beyond Rated Voltage of 200VDC>

2-2. Dimensions of Slit (Example)


Preparing the slit helps flux cleaning and resin coating on the back of the capacitor.

However, the length of the slit design should be as short as possible to prevent mechanical damage

in the capacitor.

A longer slit design might receive more severe mechanical stress from the PCB.

Recommended slit design is shown in the Table.




L×W	d	е
2.0×1.25	-	-
3.2×1.6	1.0~2.0	3.2~3.7
3.2×2.5	1.0~2.0	4.1~4.6
4.5×3.2	1.0~2.8	4.8~5.3
5.7×5.0	1.0~4.0	6.6~7.1

3. Board Design

When designing the board, keep in mind that the amount of strain which occurs will increase depending on the sizeand material of the board.

2.Item to be confirmed for Flow sordering

If you want to temporarily attach the capacitor to the board using an adhesive agent before soldering the capacitor, first be sure that the conditions are appropriate for affixing the

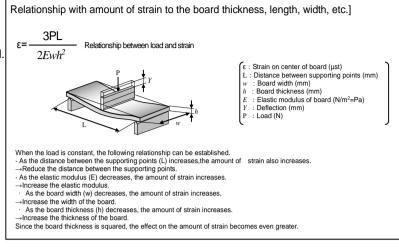

capacitor. If the dimensions of the land, the type of adhesive, the amount of coating, the contact surface area, the curing temperature, or other conditions are inappropriate, the characteristics of the capacitor may deteriorate.

1. Selection of Adhesive


- 1-1. Depending on the type of adhesive, there may be a decrease in insulation resistance. In addition, there is a chance that the capacitor might crack from contractile stress due to the difference in the contraction rate of the capacitor and the adhesive.
- 1-2. If there is not enough adhesive, the contact surface area is too small, or the curing temperature or curing time are inadequate, the adhesive strength will be insufficient and the capacitor may loosen or become disconnected during transportation or soldering. If there is too much adhesive, for example if it overflows onto the land, the result could be soldering defects, loss of electrical connection, insufficient curing, or slippage after the capacitor is mounted. Furthermore, if the curing temperature is too high or the curing time is too long, not only will the adhesive strength be reduced, but solderability may also suffer due to the effects of oxidation on the terminations (outer electrodes) of the capacitor and the land surface on the board.

(1) Selection of Adhesive

Epoxy resins are a typical class of adhesive. To select the proper adhesive, consider the following points.

- 1) There must be enough adhesive strength to prevent the component from loosening or slipping during the mounting process.
- 2) The adhesive strength must not decrease when exposed to moisture during soldering.
- 3) The adhesive must have good coatability and shape retention properties.
- 4) The adhesive must have a long pot life.
- 5) The curing time must be short.
- 6) The adhesive must not be corrosive to the exterior of the capacitor or the board.
- 7) The adhesive must have good insulation properties.
- 8) The adhesive must not emit toxic gases or otherwise be harmful to health.
- 9) The adhesive must be free of halogenated compounds.

(2) Use the following illustration as a guide to the amount of adhesive to apply. Chip Dimension (L/W) Code:21/31






2.Flux

- 2-1. An excessive amount of flux generates a large quantity of flux gas, which can cause a deterioration of solderability, so apply flux thinly and evenly throughout. (A foaming system is generally used for flow solderring.)
- 2-2. Flux containing too high a percentage of halide may cause corrosion of the terminations unless there is sufficient cleaning. Use flux with a halide content of 0.1% max.
- 2-3. Strong acidic flux can corrode the capacitor and degrade its performance. Please check the quality of capacitor after mounting.

3.Leaching of the terminations

Set temperature and time to ensure that leaching of the terminations does not exceed 25% of the chip end area as a single chip (full length of the edge A-B-C-D shown at right) and 25% of the length A-B shown as mounted on substrate.

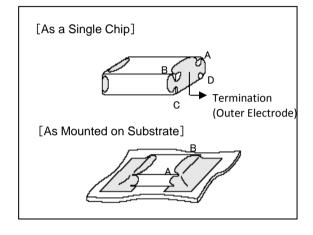

3.Reflow soldering

The flux in the solder paste contains halogen-based substances and organic acids as activators. Strong acidic flux can corrode the capacitor and degrade its performance. Please check the quality of capacitor after mounting.

4.Washing

- 1. Please evaluate the capacitor using actual cleaning equipment and conditions to confirm the quality, and select the solvent for cleaning.
- 2. Unsuitable cleaning may leave residual flux or other foreign substances, causing deterioration of electrical characteristics and the reliability of the capacitors.

5.Coating

 A crack may be caused in the capacitor due to the stress of the thermal contraction of the resin during curing process. The stress is affected by the amount of resin and curing contraction. Select a resin with low curing contraction. The difference in the thermal expansion coefficient between a coating resin or a molding resin and the capacitor may cause the destruction and deterioration of the capacitor such as a crack or peeling, and lead to the deterioration of insulation resistance or dielectric breakdown.

Select a resin for which the thermal expansion coefficient is as close to that of the capacitor as possible. A silicone resin can be used as an under-coating to buffer against the stress.

- Select a resin that is less hygroscopic. Using hygroscopic resins under high humidity conditions may cause the deterioration of the insulation resistance of a capacitor. An epoxy resin can be used as a less hygroscopic resin.
- 3. The halogen system substance and organic acid are included in coating material, and a chip corrodes by the kind of Coating material. Do not use strong acid type.

Notice

muRata

Others 1.Transportation

- 1. The performance of a capacitor may be affected by the conditions during transportation.
- 1-1. The capacitors shall be protected against excessive temperature, humidity and mechanical force during transportation.
 - (1) Climatic condition
 - low air temperature : -40°C
 - · change of temperature air/air : -25°C/+25°C
 - low air pressure : 30 kPa
 - · change of air pressure : 6 kPa/min.
 - (2) Mechanical condition

Transportation shall be done in such a way that the boxes are not deformed and forces are not directly passed on to the inner packaging.

- 1-2. Do not apply excessive vibration, shock, or pressure to the capacitor.
 - (1) When excessive mechanical shock or pressure is applied to a capacitor, chipping or cracking may occur in the ceramic body of the capacitor.
 - (2) When the sharp edge of an air driver, a soldering iron, tweezers, a chassis, etc. impacts strongly on the surface of the capacitor, the capacitor may crack and short-circuit.
- 1-3. Do not use a capacitor to which excessive shock was applied by dropping etc. A capacitor dropped accidentally during processing may be damaged.

2.Characteristics Evaluation in the Actual System

- 1. Evaluate the capacitor in the actual system, to confirm that there is no problem with the performance and specification values in a finished product before using.
- 2. Since a voltage dependency and temperature dependency exists in the capacitance of high dielectric type ceramic capacitors, the capacitance may change depending on the operating conditions in the actual system. Therefore, be sure to evaluate the various characteristics, such as the leakage current and noise absorptivity, which will affect the capacitance value of the capacitor.
- 3. In addition, voltages exceeding the predetermined surge may be applied to the capacitor by the inductance in the actual system. Evaluate the surge resistance in the actual system as required.

- 1.Please make sure that your product has been evaluated in view of your specifications with our product being mounted to your product.
- 2. Your are requested not to use our product deviating from this product specification.
- 3.We consider it not appropriate to include any terms and conditions with regard to the business transaction in the product specifications, drawings or other technical documents. Therefore, if your technical documents as above include such terms and conditions such as warranty clause, product liability clause, or intellectual property infringement liability clause, they will be deemed to be invalid.